

Radon Inspection Report

Test Location:

Valerie & Kevin Keslinger
221 West Elm Street
Littleton, NH 03561

Test For:

Valerie & Kevin Keslinger
221 West Elm Street
Littleton, NH 03561

Inspected By:

Michael Talotta
39 Remich Street
Littleton, NH 03561
802-745-7020
Lic/Cert. # 105943RT

Bldg. Type: Residential Single Family



Test Result: Pass

Overall Average:

0.6 pCi/l

EPA Average:

0.6 pCi/l

Test Device Details:

Serial Number: 235811012
Model Number: 1028XP
Last Calibration: 12/17/2018
Next Calibration: 12/17/2019
Cal-Factors: 3.0
Motion Error: No

Test Site Condition:

Structure Type: Ranch
Year Built: 1973
Sq Ft: 1680
Mitigation Sys: Installed and Active

Test Summary:

<u>CRM Location:</u>	<u>Start:</u>	<u>Stop:</u>	<u>Interval:</u>	<u>Duration:</u>
Basement	11/01/2019 03:20 PM	11/03/2019 02:20 PM	1 hr	48 hr
 	<u>Min:</u>	<u>Max:</u>	<u>Average:</u>	<u>Measurement Units:</u>
Radon Concentration:	0.0	1.7	0.6	pCi/l

Comments:




Lic/Cert Signature

Inspection Report Date: 11/06/2019



Radon Inspection Chart

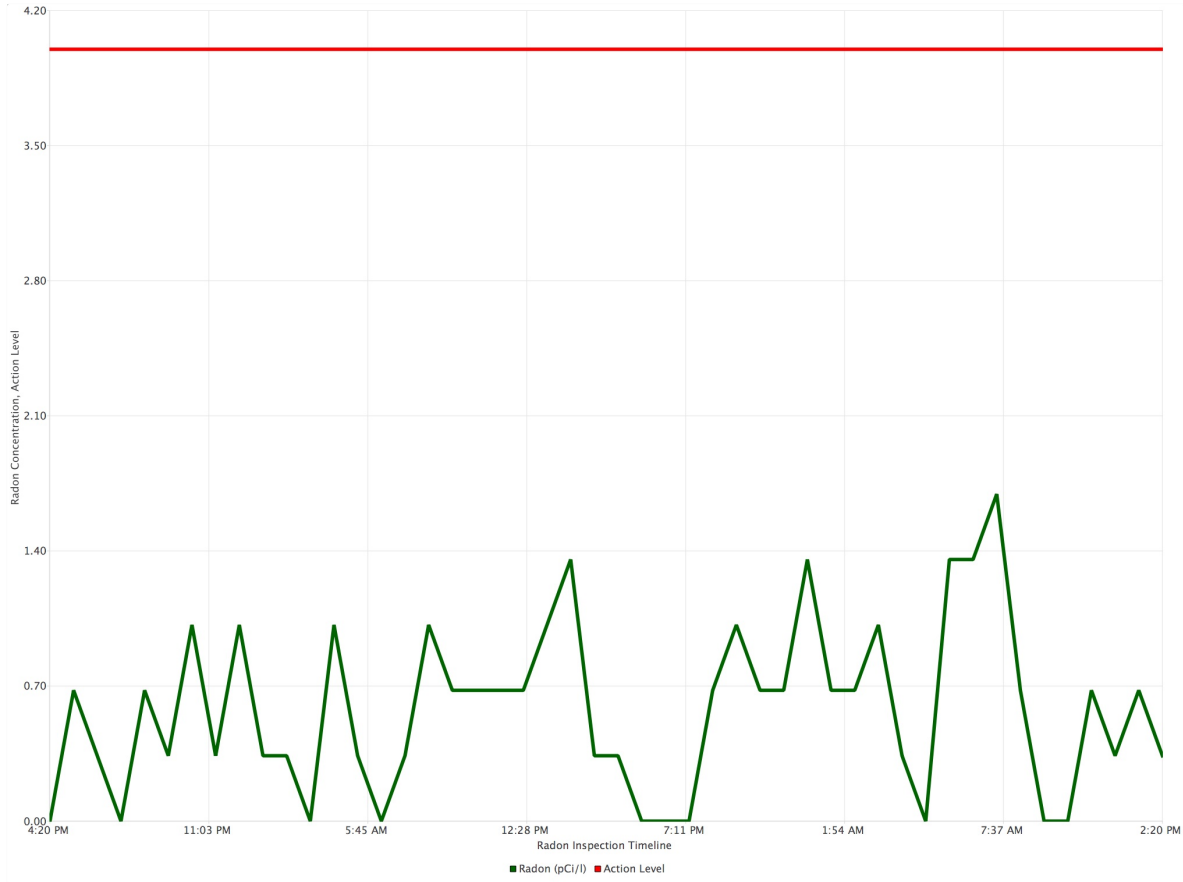

Test Result: Pass

Test Location: 221 West Elm Street Littleton, NH 03561

Inspection Report Date: 11/06/2019



Test Checklist

- The location of the detector was selected so the detector was not to be disturbed during testing.

- The monitor was not placed in an area of high humidity such as: Kitchen, laundry room, cellar, spa room, garage, crawl space or sump area.

- The detector was not located near drafts caused by HVAC vents, windows and doors.

- The detector was not placed near areas of excessive heat, such as a fireplace or in direct sunlight.

- The detector was placed within the breathing zone of at least 20 inches to 6 feet above the floor and at least 1 foot below the ceiling if suspended.

- The detector was not placed within 1 foot of outside walls of the home or within 3 feet of any windows or doors to the exterior of the home.

Test Result: Pass

Test Location: 221 West Elm Street Littleton, NH 03561

Inspection Report Date: 11/06/2019



Northern Vista Home Inspection
 39 Remich Street
 Littleton, NH 03561
 802-745-7020

Test Table

Date/Time	Radon(pCi/l)	Temp(F)	Pres(inHg)	Humidity(%)	Flags
11/01/19 04:20 PM	0.0	-	-	-	-
11/01/19 05:20 PM	0.7	-	-	-	-
11/01/19 06:20 PM	0.3	-	-	-	-
11/01/19 07:20 PM	0.0	-	-	-	-
11/01/19 08:20 PM	0.7	-	-	-	-
11/01/19 09:20 PM	0.3	-	-	-	-
11/01/19 10:20 PM	1.0	-	-	-	-
11/01/19 11:20 PM	0.3	-	-	-	-
11/02/19 12:20 AM	1.0	-	-	-	-
11/02/19 01:20 AM	0.3	-	-	-	-
11/02/19 02:20 AM	0.3	-	-	-	-
11/02/19 03:20 AM	0.0	-	-	-	-
11/02/19 04:20 AM	1.0	-	-	-	-
11/02/19 05:20 AM	0.3	-	-	-	-
11/02/19 06:20 AM	0.0	-	-	-	-
11/02/19 07:20 AM	0.3	-	-	-	-
11/02/19 08:20 AM	1.0	-	-	-	-
11/02/19 09:20 AM	0.7	-	-	-	-
11/02/19 10:20 AM	0.7	-	-	-	-
11/02/19 11:20 AM	0.7	-	-	-	-
11/02/19 12:20 PM	0.7	-	-	-	-
11/02/19 01:20 PM	1.0	-	-	-	-
11/02/19 02:20 PM	1.4	-	-	-	-
11/02/19 03:20 PM	0.3	-	-	-	-
11/02/19 04:20 PM	0.3	-	-	-	-
11/02/19 05:20 PM	0.0	-	-	-	-
11/02/19 06:20 PM	0.0	-	-	-	-
11/02/19 07:20 PM	0.0	-	-	-	-
11/02/19 08:20 PM	0.7	-	-	-	-
11/02/19 09:20 PM	1.0	-	-	-	-
11/02/19 10:20 PM	0.7	-	-	-	-
11/02/19 11:20 PM	0.7	-	-	-	-
11/03/19 12:20 AM	1.4	-	-	-	-
11/03/19 01:20 AM	0.7	-	-	-	-
11/03/19 01:20 AM	0.7	-	-	-	-
11/03/19 02:20 AM	1.0	-	-	-	-
11/03/19 03:20 AM	0.3	-	-	-	-
11/03/19 04:20 AM	0.0	-	-	-	-
11/03/19 05:20 AM	1.4	-	-	-	-
11/03/19 06:20 AM	1.4	-	-	-	-
11/03/19 07:20 AM	1.7	-	-	-	-
11/03/19 08:20 AM	0.7	-	-	-	-
11/03/19 09:20 AM	0.0	-	-	-	-
11/03/19 10:20 AM	0.0	-	-	-	-

Test Result: Pass

Test Location: 221 West Elm Street Littleton, NH 03561

Inspection Report Date: 11/06/2019



Northern Vista Home Inspection
39 Remich Street
Littleton, NH 03561
802-745-7020

Test Table

<u>Date/Time</u>	<u>Radon(pCi/l)</u>	<u>Temp(F)</u>	<u>Pres(inHg)</u>	<u>Humidity(%)</u>	<u>Flags</u>
11/03/19 11:20 AM	0.7	-	-	-	-
11/03/19 12:20 PM	0.3	-	-	-	-
11/03/19 01:20 PM	0.7	-	-	-	-
11/03/19 02:20 PM	0.3	-	-	-	-

Test Result: Pass

Test Location: 221 West Elm Street Littleton, NH 03561

Inspection Report Date: 11/06/2019



Radon Test Information

Radon Risk Information

Radon causes lung cancer by means of the decay of its daughter products after breathing in air contaminated with higher levels of Radon. The World Health Organization (WHO) estimates that 15% of lung cancers worldwide are caused by exposure to elevated indoor levels of Radon. Overall, radon is the second leading cause of lung cancer responsible for about 21,000 lung cancer deaths every year in the US alone. Radon gas is the number one cause of lung cancer among non-smokers. The U.S. Environmental Protection Agency (EPA), the U.S. Surgeon General, and the Center for Disease Control and Prevention (CDC) strongly recommend that ALL homebuyers have an indoor radon test performed prior to purchase or taking occupancy and recommend having the radon levels professionally mitigated if elevated radon concentrations are found.

Understanding Radon Test Results

Recommended Action Levels vary by country and typically range from 3 pCi/l (100 Bq/m³) to 8 pCi/l (300 Bq/m³). Recommendations below are based on test results by a Continuous Radon Monitor (CRM) Test of at least 24h duration and are based on recommendations by the EPA.

Measured Average Radon Level:

- At or above 4.0 pCi/l (148 Bq/m³): Corrective measures to reduce exposure to radon gas is strongly recommended (ANSI MAH2014)
- Between 2-4 pCi/l (74-148 Bq/m³): Consider mitigation or periodic retest as indoor Radon levels vary by season and weather conditions
- Below 2 pCi/l (74 Bq/m³): Consider bi-annual retest or whenever significant changes to the home structure or mechanical systems occurred

Test Result: Pass

Test Location: 221 West Elm Street Littleton, NH 03561

Inspection Report Date: 11/06/2019
